

SPX Corporation 5885 11th Street Rockford, IL 61109-3699 USA Tech. Services: (800) 477-8326 Fax: (800) 765-8326 Order Entry: (800) 541-1418 Fax: (800) 288-7031

Internet Address: http://www.powerteam.com


Parts List for:

C104C-EMP

MODEL D SINGLE-ACTING, SPRING RETURN HYDRAULIC CYLINDER

Maximum Capacity: 10 Ton at 10,000 PSI



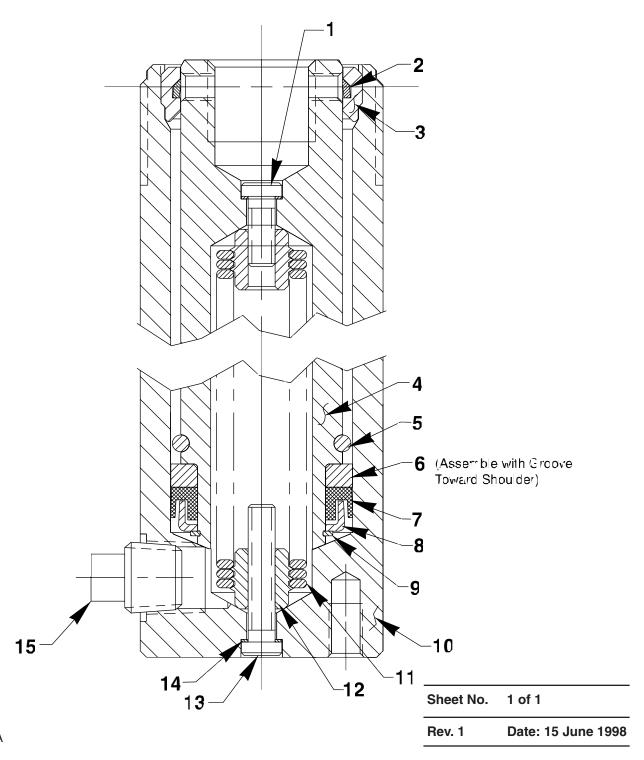

Item	Part	No.	
No.	No.	Req'd	Description
1	10006	1	Socket Head Cap Screw (1/4-20 UNC X 5/8 Lg.;
			Torque to 90/100 in.
2	201429	1	Wiper Rod
3	351030	1	Retainer Nut (Torque to 90/100 in. lbs.)
4	421643	1	Piston Rod
5	201433	1	Retainer Ring
6	201363	1	Piston Head
7	*16067	1	U-cup
	†205704	1	U-cup
8	201359	1	Slip Retainer
9	*16076	1	Retainer Ring (For 1-3/16" Shaft)
10	421760	1	Cylinder Body
11	204250	1	Extension Spring
12	201360	2	Retainer Spring
13	10020	1	Socket Head Cap Screw (1/4-20 UNC X 1-1/4" Lg.;
			Torque to 90/110 in. lbs.)
14	†*10442	2	Copper Washer (3/8 X 1/4 X 1/32)
15	211061	1	Plug Fitting (3/8 NPTF)
PARTS INCLUDED BUT NOT SHOWN			
	251451	1	Warning Decal
	†205724	1	Attention Decal (Viton seals)
	•		•


Part numbers marked with an asterisk (*) are contained in Standard Repair Kit No. 300116. Part numbers marked with a dagger (†) are contained in Viton Seal Kit No. 300211.



Note: Shaded areas reflect last revision(s) made to this form.

SPRING & RETAINER ASSEMBLY

The spring must not extend beyond the threads of the spring retainer on either end. Stretch, clean and lubricate the spring before assembly.

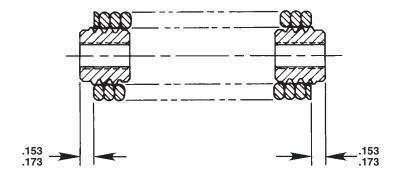

Refer to any operating instructions included with this product for detailed information about operation, testing, disassembly, reassembly, and preventive maintenance.

Items found in this parts list have been carefully tested and selected. **Therefore: Use only genuine Power Team replacement parts!**

Additional questions can be directed to our Technical Services Department.